

U.S. Fire Administration/Technical Report Series

Sprinklers Control Arson Fires in Rack-Storage Warehouse

Mt. Prospect, Illinois

USFA-TR-030/October 1988



Homeland
Security

U.S. Fire Administration Fire Investigations Program

The U.S. Fire Administration develops reports on selected major fires throughout the country. The fires usually involve multiple deaths or a large loss of property. But the primary criterion for deciding to do a report is whether it will result in significant “lessons learned.” In some cases these lessons bring to light new knowledge about fire--the effect of building construction or contents, human behavior in fire, etc. In other cases, the lessons are not new but are serious enough to highlight once again, with yet another fire tragedy report. In some cases, special reports are developed to discuss events, drills, or new technologies which are of interest to the fire service.

The reports are sent to fire magazines and are distributed at National and Regional fire meetings. The International Association of Fire Chiefs assists the USFA in disseminating the findings throughout the fire service. On a continuing basis the reports are available on request from the USFA; announcements of their availability are published widely in fire journals and newsletters.

This body of work provides detailed information on the nature of the fire problem for policymakers who must decide on allocations of resources between fire and other pressing problems, and within the fire service to improve codes and code enforcement, training, public fire education, building technology, and other related areas.

The Fire Administration, which has no regulatory authority, sends an experienced fire investigator into a community after a major incident only after having conferred with the local fire authorities to insure that the assistance and presence of the USFA would be supportive and would in no way interfere with any review of the incident they are themselves conducting. The intent is not to arrive during the event or even immediately after, but rather after the dust settles, so that a complete and objective review of all the important aspects of the incident can be made. Local authorities review the USFA’s report while it is in draft. The USFA investigator or team is available to local authorities should they wish to request technical assistance for their own investigation.

This report and its recommendations were developed by USFA staff and by TriData Corporation, Arlington, Virginia, its staff and consultants, who are under contract to assist the USFA in carrying out the Fire Reports Program.

The USFA appreciates the cooperation received from the Mt. Prospect, Illinois Fire Department and Business Services, Inc. Particular thanks go to Chief Edward A. Cavello, Deputy Chief Lonnie H. Jackson, Inspector Wallace Kueking, and Fire Protection Engineer R. Paul Valentine.

For additional copies of this report write to the U.S. Fire Administration, 16825 South Seton Avenue, Emmitsburg, Maryland 21727. The report is available on the Administration’s Web site at <http://www.usfa.dhs.gov/>

Sprinklers Control Arson Fires in Rack-Storage Warehouse Mt. Prospect, Illinois

Investigated by: April Berkol

This is Report 030 of the Major Fires Investigation Project conducted by TriData Corporation under contract EMW-88-C-2649 to the United States Fire Administration, Federal Emergency Management Agency.



**Homeland
Security**

Department of Homeland Security
United States Fire Administration
National Fire Data Center

U.S. Fire Administration

Mission Statement

As an entity of the Department of Homeland Security, the mission of the USFA is to reduce life and economic losses due to fire and related emergencies, through leadership, advocacy, coordination, and support. We serve the Nation independently, in coordination with other Federal agencies, and in partnership with fire protection and emergency service communities. With a commitment to excellence, we provide public education, training, technology, and data initiatives.



**Homeland
Security**

TABLE OF CONTENTS

OVERVIEW	1
SUMMARY OF KEY ISSUES	2
STRUCTURE AND CODES	2
FIRE PROTECTION SYSTEMS AND EQUIPMENT	2
FIRE DEPARTMENT EQUIPMENT AND TRAINING	3
THE FIRE	3
DAMAGE ASSESSMENT	4
LESSONS LEARNED	5
APPENDICES	7
APPENDIX A: Floor Plan of Structure	8
APPENDIX B: Explanation of Storage Commodity Classifications per NFPA 231C	9
APPENDIX C: Floor Plan of Structure, showing fire area	10
APPENDIX D: Mt. Prospect Fire Department Organizational Chart	11
APPENDIX E: Chicagoland Area Map locating Mt. Prospect	12
APPENDIX F: Mt. Prospect Fire Department Fire Incident Report	13
APPENDIX G: List of Photographs and Slides	15

Sprinklers Control Arson Fires in Rack-Storage Warehouse Mt. Prospect, Illinois

Local Contacts: Deputy Chief Lonnie H. Jackson
Wallace Kueking, Investigator
R. Paul Valentine, Fire Protection Engineer
Mt. Prospect Fire Department
Fire Prevention Bureau
1601 W. Golf Road
Mt. Prospect, IL 60056

Frank Springer
Vice President
Business Services, Inc.
902 Feehanville Drive
Mt. Prospect, IL 60056

OVERVIEW

Very early on the morning of October 16, 1988, a private fire alarm monitoring service received a smoke detector alarm from a Mt. Prospect warehouse. The private service then reported the alarm to the Northwest Central Fire Dispatch, which, in turn, alerted the Mt. Prospect Fire Department.

Upon arrival at the scene, the firefighters inspected the outside of the 49,000 square foot building. At first, the only indication of trouble was a sounding water motor gong. As they completed their walk around the building, they discovered water running out from under a door located at the southwest corner of the one story structure. At about the same time, a light trail of smoke was observed from the roof area of the southwest corner of the building.

The fire department then forced entry from the east side dock entrance. Upon entering the premises, they discovered that a fire had been contained by sprinkler operation to the southwest corner of the warehouse section of the business. (See Appendix A for Floor Plan.) The responding units then proceeded to extinguish the remaining fire, and remove and overhaul palletized paper products from the racks where they were stored. The fire was completely extinguished within 50 minutes of the Mt. Prospect Fire Department's arrival on the scene. Overhaul and salvage activities were completed within approximately 12 hours from arrival on the scene.

SUMMARY OF KEY ISSUES

Issues	Comments
Cause of Fire	Arson to cover a robbery.
Extinguishment of Fire	Sprinkler system, with fire department overhaul, to extinguish smoldering fires.
Building and Contents	Building is a Type 2C Building Officials and Code Administrators (BOCA) non-combustible structural steel and concrete structure. The building consists of offices and a warehouse section. Storage is on open double steel racks and consists of Class III materials on wooden pallets; some pallets contain encapsulated materials.
Fire Protection Equipment	Automatic sprinklers and smoke detectors and hand-held extinguishers were provided. A private service monitored the fire alarm and suppression system.
Damage	Final loss to be determined. No casualties or business interruption occurred.

Investigation of the fire scene revealed that multiple fires had been by a person or persons unknown in effort to cover up a burglary at the business. Successful operation of the overhead sprinkler system and the quick response of the Mt. Prospect Fire Department helped prevent a large loss, and no business interruption was experienced as a result of the fire.

STRUCTURE AND CODES

The Business Services, Inc., building was a one story structure. It contained administrative offices at the northwest end, computer room, breakroom, and clerical/word processing room on the western side, and a warehouse section with open steel, double rack storage system with a receiving/shipping area in the remaining space. There were ten rows of racks. The building is 270 feet by up to 200 feet and is approximately 49,000 square feet overall.

The five-year-old building was located in a high-rent, modern, business park. The construction type was (BOCA) Type 2C, unprotected noncombustible. The facility was a noncombustible structure with metal roof deck on steel joists with pre-cast concrete wall panels on a structural steel frame. The warehouse section is separated from the administrative offices by fire rated construction. Fire rated gypsum wallboard partitions serve to separate the computer, break, and word processing rooms from the remainder of the warehouse. The building was accessible to fire department vehicles on three sides. A creek ran along the building's northern end.

FIRE PROTECTION SYSTEMS AND EQUIPMENT

The building was fully sprinklered. The system in the warehouse section consisted of 286 F heads at the ceiling, designed to deliver a density of 0.21 gpm/square feet over 2,000 square feet. There were no in-rack sprinklers at the time of the fire. A fire department siamese connection was provided at the southwest corner of the building. Two fire hydrants were located near the structure, one near the southeast corner and the other near the southwest corner. The structure was also equipped with a fully automatic proprietary fire alarm system. Smoke detection was provided in the warehouse area. Fire extinguishers were located on every other structural column within the warehouse space. Smoking was not permitted in this area.

Water supply for fire hydrants and the building sprinklers was on the Mt. Prospect village fire lines, which are, in turn, connected to Chicago's lines. The system is deemed very good by the fire department.

FIRE DEPARTMENT EQUIPMENT AND TRAINING

Serving a population of approximately 56,000 village residents, the Mt. Prospect Fire Department employs 64 full-time firefighters and 20 paid-on-call firefighters. The department enjoys an Insurance Services Office overall rating as a Class 2 department.

The Mt. Prospect Fire Department prides itself on its on-going training program, which cover courses for State Certification, Apparatus Engineer, Hazardous Material (Hazmat), Special Rescue, Paramedic/Emergency Medical Technician, and Underwater Recovery.

The department has three fire stations: #12, #13, and #14. Station #13 is the main station and has an engine, aerial truck, squad, ambulance (mobile intensive care unit, as are all department ambulances), a reserve pumper, and a command vehicle; it has seven staff members on-duty at all times, including the shift commander. Station #14 has an engine and an ambulance, with five staff members on-duty each shift. Station #12, which is also the location of the Fire Prevention Bureau, houses the "Fire Boss" twin agent unit (chemical and AFFF), a front-line engine, an ambulance, a reserve engine, a Hazmat van, an Emergency Service Disaster Response van, generator, and a boat for water rescues. Station #12 also has five staff members on-duty at all times. The Fire Prevention Bureau is staffed by a fire protection engineer, two inspectors, the deputy chief, and a secretary. The department is in the process of adding another inspector.

The Mt. Prospect Fire Department and the members of their Fire Prevention Bureau, headed by Deputy Chief Lonnie H. Jackson, provide public education programs presented to school children and senior citizens' groups throughout the year. A door-to-door campaign over a three year period has achieved a 90 percent level of smoke detector usage in private residences. The department makes repeat visits to verify and re-educate residents on the use and care of smoke detectors in the home. The department has won the State Fire Prevention Award for 15 years running. The department is proud of its record of five years without a death due to fire.

THE FIRE

First indication of the fire occurred just prior to 0149 on October 16, 1988, when a smoke detector alarm was received by a private alarm monitoring service. This was called into the Northwest Central Fire Dispatch Office at 0149. The first units were out of the station at 0150 and arrived on the scene at 0154. The actual ignition is thought to have occurred between 1200 hours, when the last employees left the premises, and 0149, when the smoke detector alarm was recorded.

The first arriving units were from Stations #14 and #13, and consisted of two engines, an aerial truck, the shift commander, and an ambulance. Initially, the crews did not observe any signs of fire other than the ringing water motor gong, water was seen running out from under a door on the southwest corner, near the fire department siamese connection. A second alarm was called in at 0204 summoning Fire Chief Cavello, another ambulance, and Reserve Squad 13. Mutual aid was received from two neighboring towns.

Forced entry was made from the loading dock service entrance on the east side of the building. Engine 13 laid in a 3-inch line from the loading dock side, while Engine 14 gained entry on the west side, laying in a 1-1/2-inch line. Engine 14 also connected to the fire department connection to charge the sprinkler system. Ventilation was provided from the roof by Aerial Truck 13.

The first entering firefighters encountered large amounts of smoke. Once the firefighters were able to open the overhead doors to the loading dock, they laid in attack lines. The fire was completely

extinguished by 0244 when overhaul activities began. Salvage and overhaul was completed at 1453. A total of 26 personnel, four engines, one aerial truck, and six other vehicles responded to this fire.

Once the fire was brought under control, it was determined that multiple fires had been deliberately set in the southwest corner of the warehouse section. The fire department investigator and the Fire Marshal's investigator were called to the scene. Further investigation of the scene revealed that a secure area had been breached and items appeared to be missing from this area. Also, a dollar-bill-changing machine in the breakroom was found to have been broken into. The Mt. Prospect Police Department was called to the scene upon discovery of the apparent burglary.

The fires had been intentionally set in paper goods stored on wooden pallets lying in the second aisle between the first row of double racks from the southern end of the building. The fire then spread to packed goods on the lower level of the nearest double rack. In all, approximately five bays of the southern-most double rack, and about three bays of the single width rack system on the southern wall of the building were affected. These bays were damaged due to the heat developed by the fire.

Although the building did not suffer any structural damage, a skylight located above the fire area failed prior to extinguishment. This failure is thought to have occurred soon after the time the first responding units arrived on the scene. This is based on the fact that no outward signs of fire were observed upon arrival, but once the fire department completed its walk around the building, smoke was simultaneously observed from the loading dock area and the roof at the southwestern end of the structure.

Promotional fliers, pamphlets, and brochures used for marketing purposes were stored in the racks. Business Services, Inc., was a marketing services company engaged in mass mailings of promotional material. Goods are packed in paper-wrapped bundles or cartons, grouped on wooden pallets, and occasionally encapsulated (covered on both top and sides by plastic sheeting). The storage scheme consists of double racks with storage on four levels up to approximately 20 feet. The goods are reconsidered a Class III commodity by National Fire Protection Association (NFPA) 231C, *Rack Storage of Materials*. (For an explanation of commodity classification, see Appendix B.)

DAMAGE ASSESSMENT

Damage from the incident was primarily due to water. A total of 20 heads eventually fused as the sprinkler system operated to contain the fires. Upon entering the premises, the fire department noted ankle-deep water throughout. Sprinkler operation and fire department operations were limited to the southwestern sections of the building.

It is interesting to note that the sprinkler system design required by NFPA 231C for this type of commodity and storage configuration calls for 286 F heads at the ceiling, with a higher design density, and one level of in-rack sprinklers.

Summary of Sprinkler Protection Issues – Actual versus Required

ACTUAL		REQUIRED	
1	286 F sprinkler heads at the ceiling	1	286 F sprinkler heads at the ceiling
2	No in-rack sprinkler heads	2	One level of in-rack sprinkler heads rated at 165 F
3	A design density of 0.21 gpm/square feet over most remote 2,000 square feet	3	A design density of 0.28 gpm/square feet over most remote 2,000 square feet

Although the system as actually designed and installed contained this fire, it is likely that fewer heads would have operated and the fire might have been contained by in-rack sprinklers if they had been present. This would predictably have limited the degree of water damage. Although a final dollar value was unavailable at the time of this report, the fire loss estimates place it at over one million dollars.

Successful operation of the sprinkler system, and the efficient manner in which the fire department attacked the fire, prevented it from spreading into the adjacent data processing rooms. These areas were found with several inches of water on the floor; however, no damage was suffered by any of the equipment.

LESSONS LEARNED

1. A well organized monitoring and alarm reporting system enables fires to be responded to earlier in their progress.

The smooth interaction of the private monitoring system with the Northwest Central Fire Dispatch Center, which actually coordinates all fire departments in the surrounding villages, was instrumental in the outcome of this incident.

2. Even though the sprinkler system was not designed to handle the commodity type and storage configuration employed, it contained the fire.

An excessive number of heads fused as the system attempted to cope with the set fires. The combination of a prompt alarm and effective fire department response produced a favorable outcome in this incident. The lack of in-rack sprinklers and the lower design density might have been ineffective in confining the fire under different circumstances.

3. There may be a need for providing some means of protecting sprinkler system valves from vandals.

An interesting outcome of this fire is that though the fires were set to hide a burglary, the perpetrator could have caused considerably more damage if he/she had shut down the sprinkler system. The fires were set within 20 feet of the easily accessible sprinkler valve.

4. Business owners need to be educated about the value of good fire prevention practices as well as sprinkler system and fire department operations.

One of the positive results of the incident has been the heightened awareness of the business owner with regard to fire department operations. Previously, the owner assumed that fire department personnel, in their attack and overhaul, would cause increased levels of loss and damage. This fire and the fire department's subsequent actions to aid in the clean-up of the scene proved that to be untrue.

This fire brought Business Services, Inc., and the fire department closer. The incident also dispelled the owner's false belief that, in a fire, all heads of a sprinkler system would operate simultaneously. The business owner admits to a heightened awareness and concern for codes and standards, to wit, maintaining clear aisle widths between racks, clearing of combustible debris, and, in general, conforming to recommend storage practices. As the owner stated, before the fire, the objective was to maximize the use of the high rent storage space at the expense of good fire prevention practices.


5. When a business depends heavily on its data processing capabilities, an increased level of protection for its computers and related equipment is good business sense.

The fire increased the owners' general awareness of fire safety. Also, the business owner asserted that they were fortunate not have lost any of their data processing capabilities in this incident and were now considering a Halon system for this sensitive area.

APPENDICES

- A. Floor Plan of Structure; shows locations from which Berkol photos were taken.
- B. Explanation of Storage Commodity Classifications per NFPA 231C.
- C. Floor Plan of Structure, showing fire area.
- D. Mt. Prospect Fire Department Organizational Chart.
- E. Chicagoland Area Map locating Mt. Prospect.
- F. Mt. Prospect Fire Department Fire Incident Report.
- G. List of Slides and Photographs, followed by selected reproductions. (Slides and photographs are included with the master report at the USFA.)

APPENDIX A

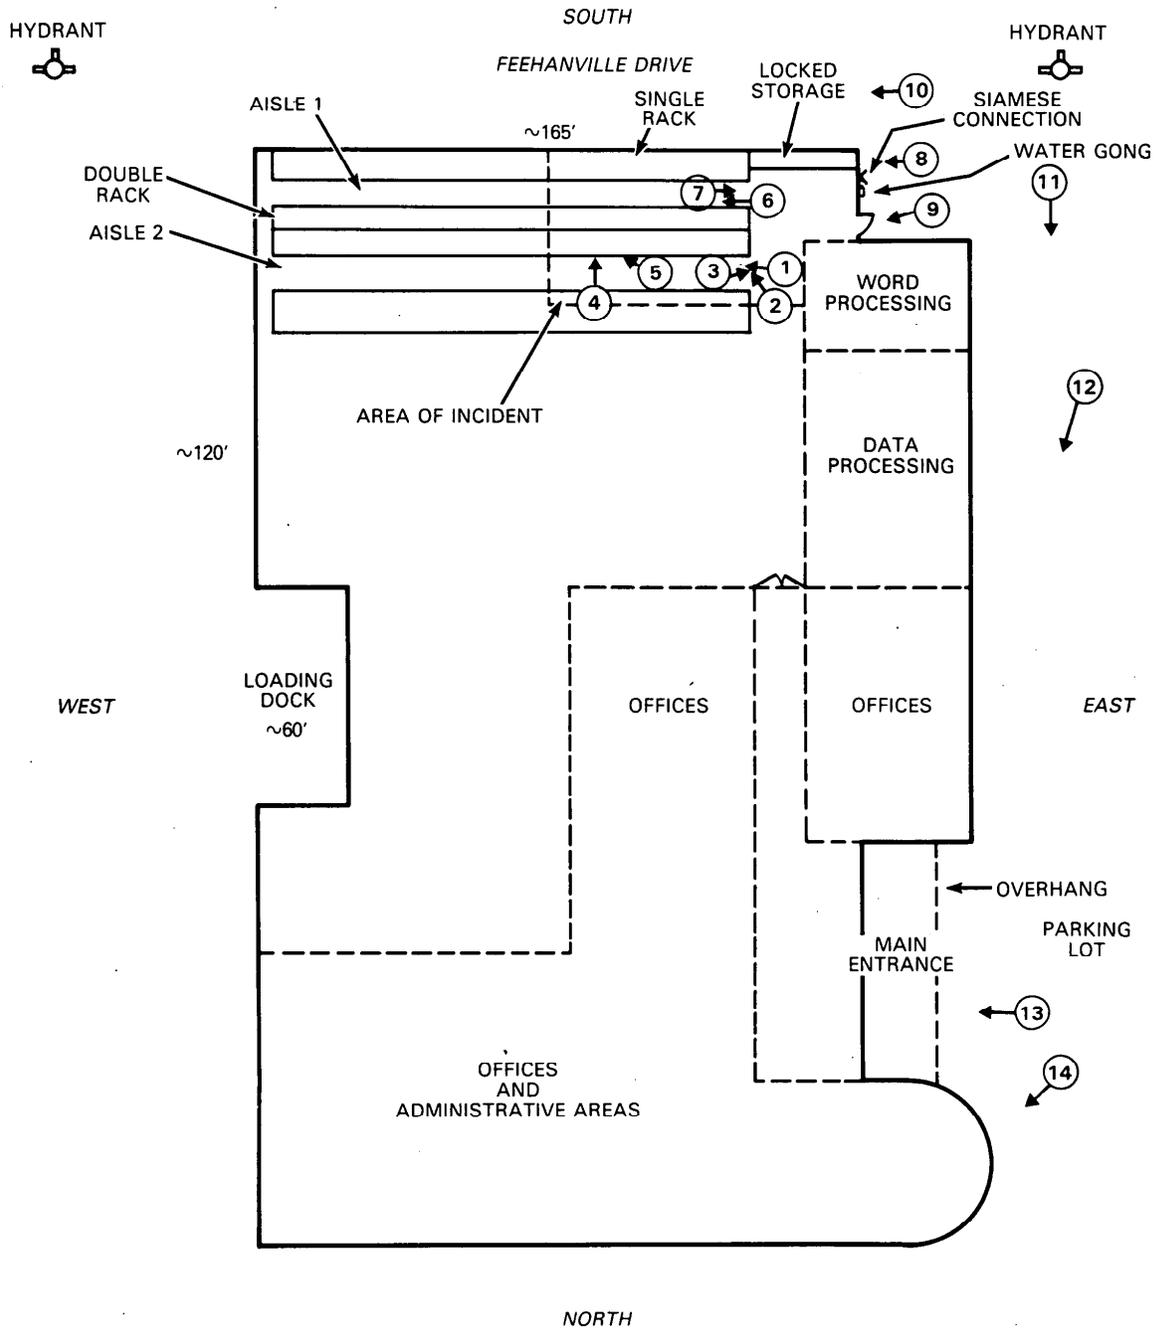

APPENDIX B

EXPLANATION OF STORAGE COMMODITY CLASSIFICATIONS PER NFPA 231C

Class I commodities are essentially non-combustible items, i.e., metal products, glass, foods and the like.

Class II commodities are Class I commodities in slatted wooden crates, solid wooden boxes, and the like on wood pallets, i.e., light bulbs, beer, wine, thinly coated fine wire and the like.

Class III commodities are ordinary combustibles such as wood, paper, natural fiber cloth, and Group C plastics such (PVC, urea formaldehyde, etc.) on wooden pallets.


The commodity type in this storage space consisted of pamphlets, brochures, and similar promotional paper products, packed cartons, stacked on wooden pallets of which some were partially encapsulated in plastic sheet.

This information is included for informational purposes only. Complete information of sprinkler requirements for rack storage can be found in NFPA 231C, *Rack Storage of Materials*.


APPENDIX C




BUSINESS SERVICES WAREHOUSE MT. PROSPECT, ILLINOIS

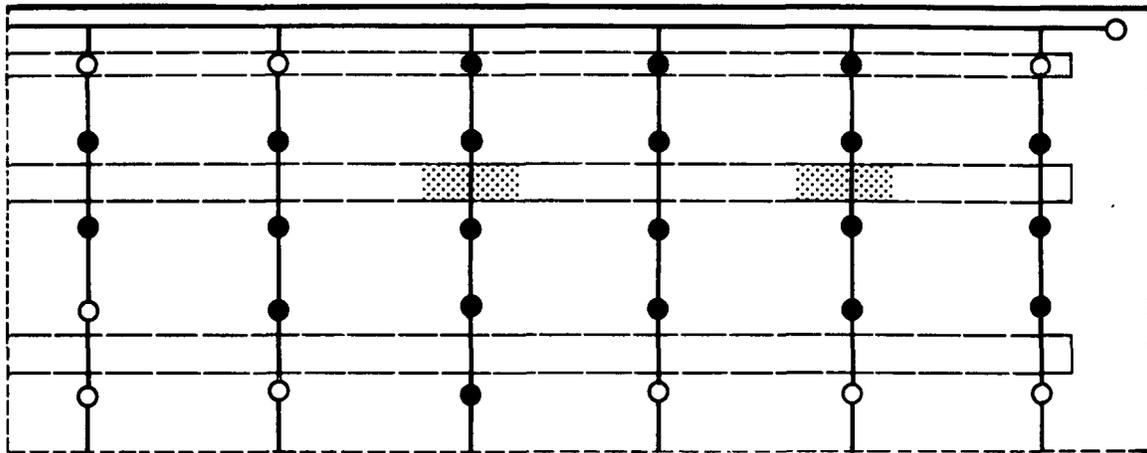


Blow-up diagram of fire area

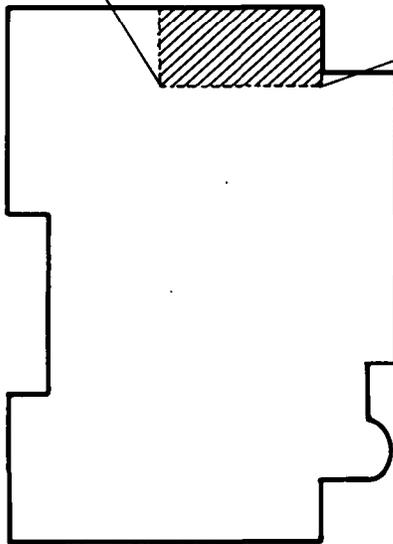

Outline of building showing fire area

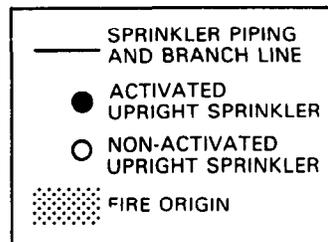

APPENDIX D

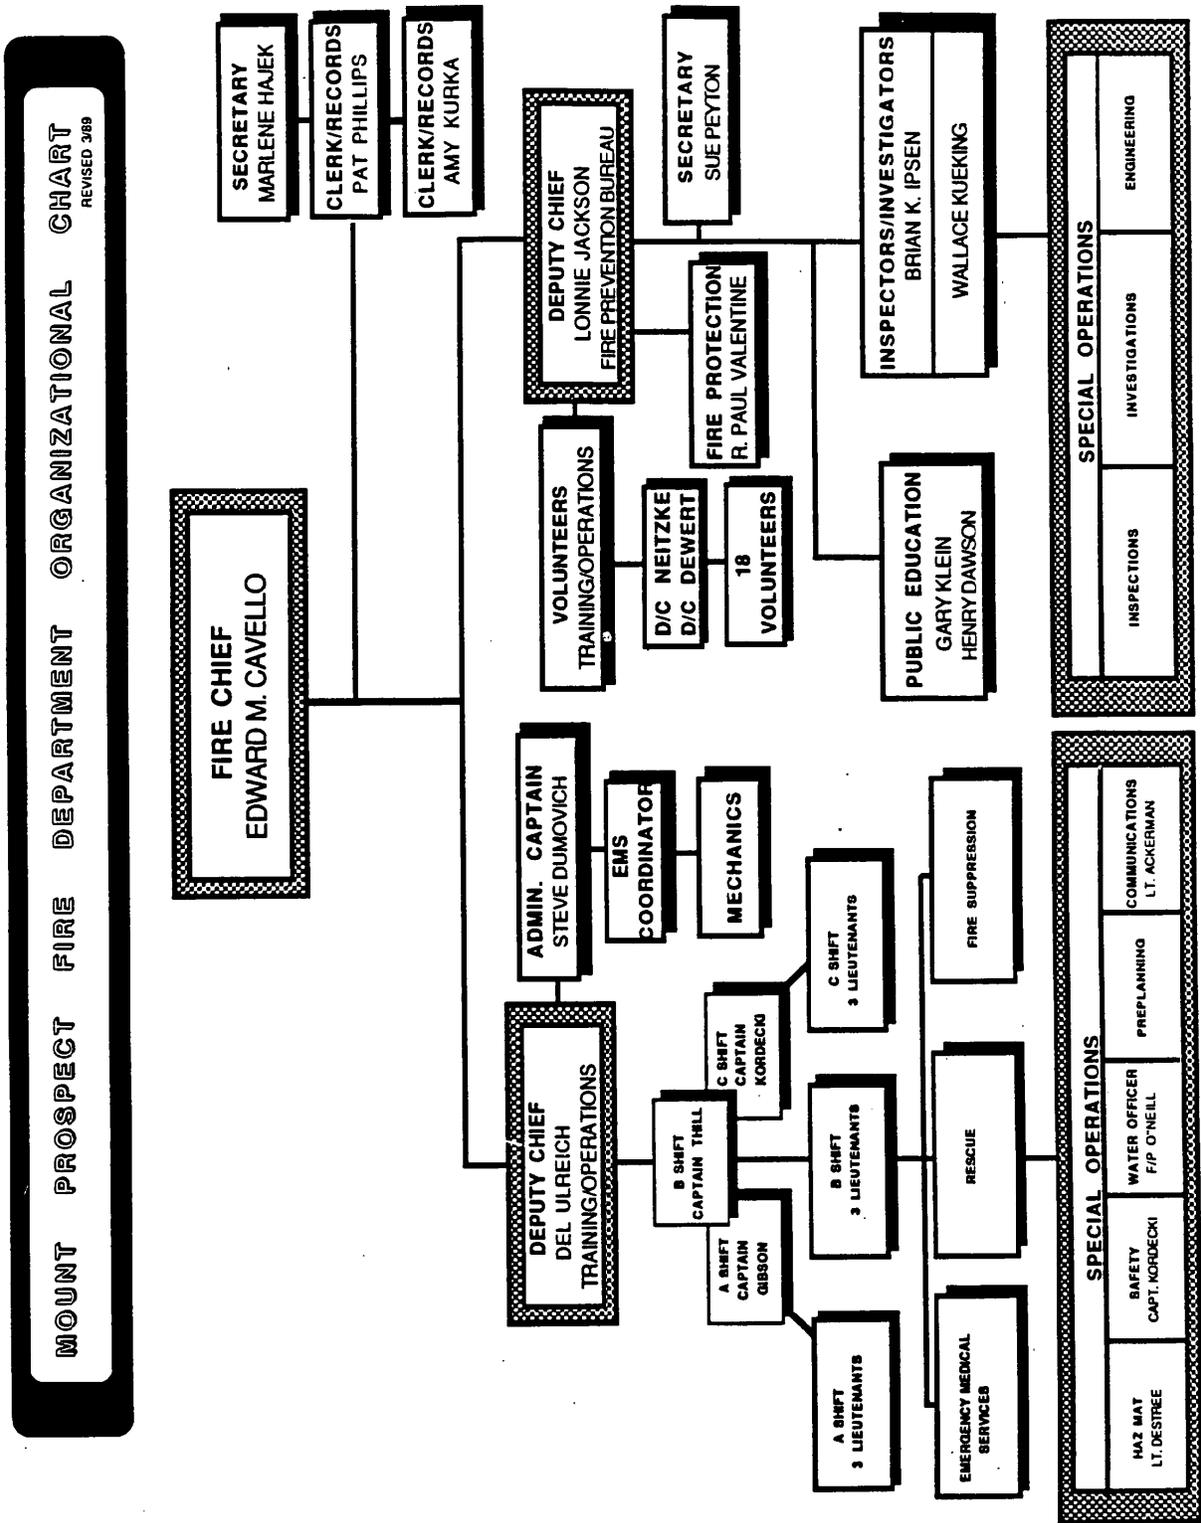

APPENDIX F



MOUNT PROSPECT FIRE DEPARTMENT

112 E. NORTHWEST HIGHWAY MOUNT PROSPECT, ILLINOIS 60056

FIRE INCIDENT REPORT

FD#	INCIDENT NO.	UP NO.	NO.	DAY	YEAR	DAY OF WEEK	ALARM TIME	TIME ARRIVED	IN SERVICE
C, N, 3, 4, 2	88-3212	00	10	16	88	Sunday	10:15	10:15	11:11

TYPE OF SITUATION FOUND Structure <input checked="" type="checkbox"/> 1 Outside of Structure <input type="checkbox"/> 12 Vehicle <input type="checkbox"/> 13 Trees/Brush/Grass <input type="checkbox"/> 14 Refuse <input type="checkbox"/> 15	TYPE OF ACTION TAKEN Extinguishment <input checked="" type="checkbox"/> 1 Investigation-Only <input type="checkbox"/> 3	MUTUAL AID None <input type="checkbox"/> Received <input checked="" type="checkbox"/> 1 From <u>E.C.F.D.</u>
FIXED PROPERTY USE Not Applicable <input type="checkbox"/> 008 1-Family Dwelling-Year <input type="checkbox"/> 411 2-Family Dwelling-Year <input type="checkbox"/> 414 3-6 Unit Apt/Term/Flat <input type="checkbox"/> 422 7-20 Unit Apt/Term/Flat <input type="checkbox"/> 423 + 20 Unit Apt/Term/Flat <input type="checkbox"/> 424 Resident Parking/Garage <input type="checkbox"/> 881 Vacant Property <input type="checkbox"/> 915 Open Land/Field <input type="checkbox"/> 931 Vacant Lot <input type="checkbox"/> 936 Railroad Right of Way <input type="checkbox"/> 951 Limit Access/Divid Hwy <input type="checkbox"/> 961 Paved Public Street <input type="checkbox"/> 962 Paved Private St/Way <input type="checkbox"/> 963 Unpaved St/Rd/Path <input type="checkbox"/> 964 Uncovered Parking Area <input type="checkbox"/> 965 Paper Products <input checked="" type="checkbox"/> 855	IGNITION FACTOR Undetermined <input type="checkbox"/> 00 Incandant-No Civi Disrb <input type="checkbox"/> 11 Suspicious-No Civi Disrb <input checked="" type="checkbox"/> 12-27 Abandoned Material <input type="checkbox"/> 31 Inadeq Contn/Open Flame <input type="checkbox"/> 34 Child Playing <input type="checkbox"/> 36 Combust/Too Close Heat <input type="checkbox"/> 46 Part Failure/Leak/Break <input type="checkbox"/> 51 Sht Crc/Grnd Fault <input type="checkbox"/> 54 Other Elec Failure <input type="checkbox"/> 55 Lack of Maintenance <input type="checkbox"/> 56 Backfire <input type="checkbox"/> 57 Unattended Operation <input type="checkbox"/> 73	

CORRECT ADDRESS, CITY <u>902 FEEHANVILLE</u>	ZIP CODE <u>60056</u>	CENSUS TRACT <u>80-27-090</u>
OCCUPANT LAST NAME, FIRST NAME <u>BUSINESS SERVICES INC</u>		PHONE <u>847-271-1000</u>
OWNER LAST NAME, FIRST NAME, M.I. <u>BUSINESS SERVICES INC</u>		OWNER ADDRESS, CITY <u>902 FEEHANVILLE</u>

METHOD OF ALARM FROM PUBLIC Telephone-Clien <input type="checkbox"/> 1 Private Fire Alarm <input checked="" type="checkbox"/> 2-3 Radio <input type="checkbox"/> 4 Direct Verbal Report <input type="checkbox"/> 5 Telephone Tie-Line <input type="checkbox"/> 7	CO INSP LIST <u>10/18</u>	SHIFT	# ALARMS
--	------------------------------	-------	----------

NO. FIRE SERVICE PERSONNEL RESPONDED <u>26</u>	NO. ENGINES RESPONDED <u>4</u>	NO. AERIAL APPARATUS RESPONDED	NO. OTHER VEHICLES RESPONDED <u>6</u>
NUMBER INCIDENT-RELATED INJURIES FIRE SERVICE <u>0</u> OTHER <u>0</u>	NUMBER INCIDENT-RELATED FATALITIES FIRE SERVICE <u>0</u> OTHER <u>0</u>		

COMPLEX Dwelling <input type="checkbox"/> 41 Apartment <input type="checkbox"/> 42 Shopping <input type="checkbox"/> 58 Road <input type="checkbox"/> 96 No Complex <input type="checkbox"/> 98 Warehouse <input checked="" type="checkbox"/> 80	MOBILE PROPERTY TYPE (If any, do line 5) Undetermined <input type="checkbox"/> 00 Not Applicable <input checked="" type="checkbox"/> 08 Automobile <input type="checkbox"/> 11 Mobile Home <input type="checkbox"/> 17 Truck over 1 Ton <input type="checkbox"/> 21 Truck-Gen Under 1 Ton <input type="checkbox"/> 22
---	---

AREA OF ORIGIN Undetermined <input type="checkbox"/> 00 Lounge Area <input type="checkbox"/> 14 Sleep Rm Under 5 People <input type="checkbox"/> 21 Kitchen/Cooking Area <input type="checkbox"/> 24 Trash Area/Container <input type="checkbox"/> 46 Garage/Carport/Storage <input type="checkbox"/> 47 Trans Exp/Passagr Area <input type="checkbox"/> 81 Engrn Area of Trans Exp <input type="checkbox"/> 83 Railroad Embankment <input type="checkbox"/> 91 Highway/Public Way/St <input type="checkbox"/> 92 Lawn/Field/Open Area <input type="checkbox"/> 94 Storage Area <input checked="" type="checkbox"/> 46	EQUIPMENT INVOLVED IN IGNITION (If any, do line 7) Undetermined <input type="checkbox"/> 00 Fed. Stary Lcd Htg Unit <input type="checkbox"/> 13 Portable Local Htg Unit <input type="checkbox"/> 15 Chimney, Gas Vent Flu <input type="checkbox"/> 16 Fixd/Stary Surf Unit <input type="checkbox"/> 21 Open Fire Grill <input type="checkbox"/> 28 Cord. Plug <input type="checkbox"/> 47 Vehicle <input type="checkbox"/> 96 No Equipment Involved <input checked="" type="checkbox"/> 98
---	---

FORM OF HEAT OF IGNITION Undetermined <input checked="" type="checkbox"/> 00 Sparks/Gas Fueled Eqp <input type="checkbox"/> 11 Heat/Gas Fueled Eqp <input type="checkbox"/> 12 Spark/Liq Fueled Eqp <input type="checkbox"/> 13 Heat/Liq Fueled Eqp <input type="checkbox"/> 14 Short Circuit-Bad Intl <input type="checkbox"/> 23 Short Circuit-Unspec <input type="checkbox"/> 24 Overloaded Eqp <input type="checkbox"/> 27 Cigarette <input type="checkbox"/> 31 Match <input type="checkbox"/> 45 Open Fire <input type="checkbox"/> 47 Backfire From Engine <input type="checkbox"/> 48 Friction <input type="checkbox"/> 51 Reignition/Retinidle <input type="checkbox"/> 55 Property Oper Elec Eqp <input type="checkbox"/> 56 Fireworks <input type="checkbox"/> 63 Lightning Discharge <input type="checkbox"/> 73 Radiated Heat <input type="checkbox"/> 82	TYPE OF MATERIAL IGNITED Undetermined <input type="checkbox"/> 00 Gasoline <input type="checkbox"/> 23 Fat/Grease (Food) <input type="checkbox"/> 31 Plastic—Unclassified <input type="checkbox"/> 40 Rubber <input type="checkbox"/> 51 Grass/Leaves <input type="checkbox"/> 54 Sawn Wood <input type="checkbox"/> 63 Untreated Paper <input type="checkbox"/> 67 Man-Made Fiber <input type="checkbox"/> 71 Cotton/Rayon <input type="checkbox"/> 72 Multiple Types <input checked="" type="checkbox"/> 97	FORM OF MATERIAL IGNITED Undetermined <input type="checkbox"/> 00 Structural Member <input type="checkbox"/> 07 Upholstered Sofa/Chair <input type="checkbox"/> 21 Electrical Wire <input type="checkbox"/> 61 Fuel <input type="checkbox"/> 65 Growing/Living Form <input type="checkbox"/> 74 Rubbish/Trash <input type="checkbox"/> 75 Cooking Material <input type="checkbox"/> 76 Gas/Liquid From Pipe <input type="checkbox"/> 86 Multiple Form <input checked="" type="checkbox"/> 97
---	---	---

COMPLETE ON ALL INCIDENTS

COMPLETE ON ALL FIRE INCIDENTS

* If appropriate codes are not shown please refer to PLUMBING and MECHANICAL on report in the proper field or section.
 ** If any, complete Cause Report.

CONTINUED ON REVERSE SIDE

Appendix F continued

Self Extinguished <input type="checkbox"/> 1 Make-Shift Aids <input type="checkbox"/> 2 Portable Extinguisher <input type="checkbox"/> 3	Precon Hose Tank Water <input type="checkbox"/> 5 Precon Hose Hydrant Wty <input type="checkbox"/> 6 Haz Lines <input checked="" type="checkbox"/> 7	Grade Level-9 Ft Above <input checked="" type="checkbox"/> 1 10-19 Ft Above <input type="checkbox"/> 2 Below Grnd/Water Level <input type="checkbox"/> 3
--	--	--

COMPLETE LINES N - Q FOR STRUCTURE FIRES ONLY

N NUMBER OF STORIES <input checked="" type="checkbox"/> 1 <input type="checkbox"/> 2 <input type="checkbox"/> 3 <input type="checkbox"/> 4	CONSTRUCTION TYPE Fire Resistant <input checked="" type="checkbox"/> 1 Unprotected Ordinary <input type="checkbox"/> 6 Protected Wood Frame <input type="checkbox"/> 7 Unprotected Wood Frame <input type="checkbox"/> 8
O EXTENT OF FLAME DAMAGE Object <input type="checkbox"/> 1 Part Room <input type="checkbox"/> 2 Room <input checked="" type="checkbox"/> 3	EXTENT OF SMOKE DAMAGE Object <input type="checkbox"/> 1 Part Room <input type="checkbox"/> 2 Room <input type="checkbox"/> 3 Building <input checked="" type="checkbox"/> 6
P DETECTOR PERFORMANCE No Detectors Present <input type="checkbox"/> 8	SPRINKLER PERFORMANCE No Equip Present <input type="checkbox"/> 8

Q IF SMOKE SPREAD BEYOND ROOM OF ORIGIN: TYPE OF MATERIAL GENERATING MOST SMOKE: Undetermined <input type="checkbox"/> 00 Gasoline <input type="checkbox"/> 23 Fat/Grease (Food) <input type="checkbox"/> 31 Plastic-Unclassified <input type="checkbox"/> 40 Rubber <input type="checkbox"/> 51 Grass/Leaves <input type="checkbox"/> 54 Sawn Wood <input type="checkbox"/> 63 Untreated Paper <input type="checkbox"/> 67 Man-Made Fiber <input type="checkbox"/> 71 Cotton/Rayon <input type="checkbox"/> 72 Multiple Types <input checked="" type="checkbox"/> 97	AVENUE OF SMOKE TRAVEL Not Determined/Reported <input type="checkbox"/> 0 Corridor <input checked="" type="checkbox"/> 2 Opening in Construction <input type="checkbox"/> 3 No Significant Avenue <input type="checkbox"/> 8
---	---

R FORM OF MATERIAL GENERATING MOST SMOKE: Undetermined <input type="checkbox"/> 00 Structural Member <input type="checkbox"/> 17 Upholstered Sofa/Chair <input type="checkbox"/> 21 Electrical Wire <input type="checkbox"/> 61 Fuel <input type="checkbox"/> 65 Growing/Living Form <input type="checkbox"/> 74 Rubbish/Trash <input type="checkbox"/> 75 Cooking Material <input type="checkbox"/> 76 Gas/Liquid From Pipe <input type="checkbox"/> 86 Multiple Form <input checked="" type="checkbox"/> 97
--

IF VEHICLE PROPERTY	YEAR	MAKE	MODEL	SERIAL NO.	LICENSE NO.
IF EQUIPMENT INVOLVED IN IGNITION	YEAR	MAKE	MODEL	SERIAL NO.	

OFFICER IN CHARGE (name, position, assignment) <i>CAPT. GIBSON</i>	WEATHER <i>Cloudy</i>	TEMPERATURE <i>60°</i>	WIND DIRECTION AND VELOCITY <i>SW-10</i>
---	--------------------------	---------------------------	---

INDIVIDUAL MAKING REPORT (name, position, address) <i>Lt. H.P. Clark</i>	P.P.S. INVESTIGATION (Y-N) <i>YES</i> INVESTIGATOR NAME <i>K. King</i>
RESP. P.D. UNITS * TIME DISPATCHED TIME ARRIVED TIME IN-SERV. HANDOVER 1. <i>512</i> <i>01:50</i> <i>01:54</i> <i>26</i>	
ESTIMATED VALUE OF PROPERTY: <i>2,000,000</i> *List first due engine in first position (EX: 512 or 525)	

OPTIONAL COMMENT AREA: *upon Arrival Noticed Water Gong operating. Checked bld & Found Smoke in loading dock. Forced Entry Service door next to over head doors. Open them and laid 3" to loading dock. Stacked 2 lines from wye as attack lines. (1 1/2 + 1 3/4). TK forced W. Side door & laid 1 1/2 to fire. Much High Stacked Paper Products (20+). Noticed 2 Areas of Origin. TK to Roof for Ventilation. E14 or Siamese, E13 lead out. Eng 13+14 attack lines. TK is third attack line.*

APPENDIX G

LIST OF PHOTOGRAPHS AND SLIDES

Slides and photographs are included with the master report at the USFA. The pictures on the following pages were made from the items asterisked below.

Provided by Wally Keuking, Mt. Prospect Fire Department

1. Looking due south from first double rack at single rack on south wall. Shows southwest end of single rack and start of locked storage area to its right.
- *2. Looking due southwest from the second aisle. The main sprinkler riser is visible just above the firefighter's right hand.
3. Shows damage to goods stored.
4. Shows breakroom with burglarized change machine.
- *5. Looking up aisle three, damage to rear of racks is evident at far end.
6. Main entrance to building.
- *7. Typical damage to goods on upper level of racks
8. Looking due south at door leading to warehouse section. Shows extent of water penetration due to fire
9. Data processing room, showing water accumulation on floor
10. Data processing room. Shows extent of water penetration. No damage to equipment
- 11-14. From aisle two showing fire damage to first double rack and single rack at southwest end of warehouse
15. Looking upwards from aisle two at area of metal deck roof where fire impinged on ceiling
16. Wood processing room. Shows extent of water penetration. No fire damage
17. From aisle two showing fire damage to storage racks
- *18. Typical fire damage to goods on rack in aisle two
19. From aisle two, showing fire damage to storage racks
- *20. Failed skylight above aisle one. Note sprinkler piping
- 21-30. Shots taken west and due east from aisle two showing extent of fire damage to goods and rack
- *28. Overall view of fire area showing damage to racks

Taken by A. L. Berkol

31. Looking down aisle two between first two double racks; looking from west to east. Shows new double racks
32. Looking down aisle two from the southwestern corner of second row of double racks. Shows location of one of the set fires
33. Looking towards southwestern corner of building from southwestern corner of second double rack. Shows location of sprinkler valve
34. Looking upwards from mid-section of new portion of first row of double racks. Shows effects of fire on metal roof deck to left of failed skylight
35. Looking upwards from second row of double racks at roof area affected by fire. Shows effects of fire on metal roof deck
36. Looking down aisle one to the eastern end of building. Shows new bays of single rack on southern wall of building
37. Looking due west from aisle one at western wall with locked storage area to left and sprinkler valve dead ahead. Shows sprinkler valve location.

38. Looking due west at southwestern exterior corner of building. Shows location of water gong and fire department connection
- *39. Northeast view of exterior of warehouse section showing fire department connection and door used to gain entry on west side of building
40. Looking due east from exterior western corner. Shows precast concrete panel walls of structure.
- *41. Looking north along southwestern corner of building. The main entrance is visible at far end of building
42. Looking due northwest from parking lot towards main entrance. Shows main entrance to building as well as part of the administrative section office windows
43. Looking due northeast towards main entrance. Shows main entrance to building
44. Looking due northeast at northwestern corner of building. Shows northwest corner of building and the creek which runs east to west at northern end of building.

2



5



best available image




7

best available image



9

18

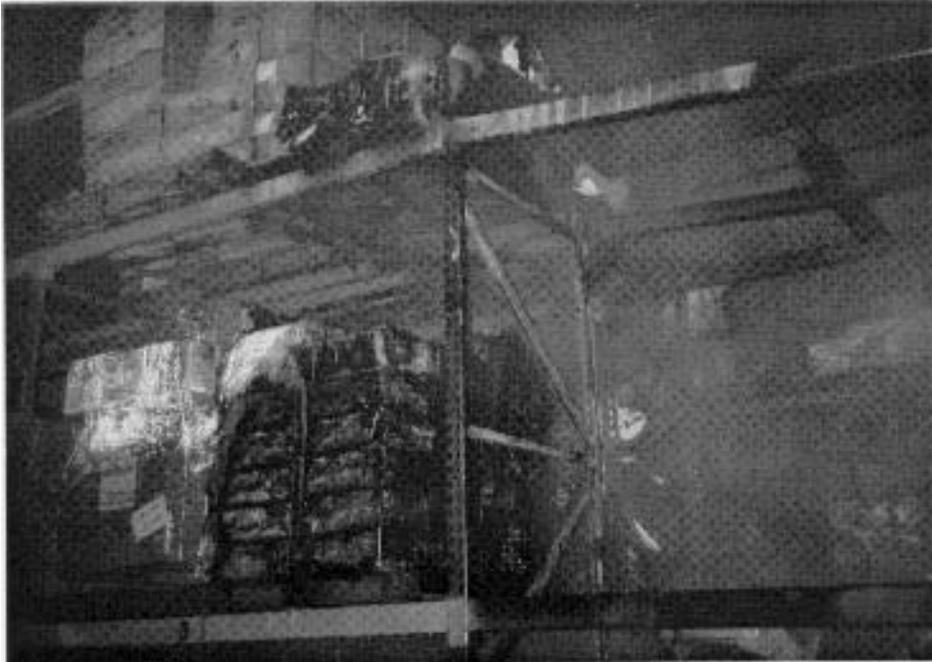

best available image

20



best available image



best available image

